

## How to Use the WarmMark®

WarmMark is a single-use, ascending time-temperature indicator which alerts users of exposure to unacceptable temperature conditions.

### Arming and Use: WarmMark Short Run, Long Run, Duo

- All WarmMark® breach window(s) should be white prior to arming the device.
- Before arming, the WarmMark indicator should be placed in an environment at least 5°C (9°F) below the WarmMark's activation threshold temperature for a minimum of 30 minutes.
- To arm the WarmMark indicator, fold up and pull out the indicator's activation tab until the tab and barrier film have been completely removed.
- If using a WarmMark indicator with an activation threshold temperature below the ambient temperature, immediately place the indicator in the environment to be monitored to avoid activation.
- Remove the adhesive liner from the WarmMark and adhere the indicator to a clean, dry surface.
  - The WarmMark should be located where it will be visible to the receiver of the monitored shipment.
  - The WarmMark can be adhered directly to the product being monitored or located inside the packaging.
- Any sign of color in the breach window(s) after arming, including light pink, pink, or red, is a sign of temperature excursion equal to or above the time and temperature specification.

### Interpreting the WarmMark


Reference #6 above. When the WarmMark is exposed to conditions above the indicator's activation temperature  $\pm 1^\circ\text{C}$  ( $\pm 2^\circ\text{F}$ ), a red dye will begin migrating through the run-out window(s).

Run out times are based on a constant temperature 2°C above the indicator temperature threshold. Exposure to higher temperatures will result in faster run out. Brief (Window 1) and Moderate (Window 2) time figures are for guidance, while the Prolonged (Window 3 or only window) is controlled to the time specification.

### Storage Recommendations

WarmMark indicators should be stored below their response temperature and below 55% relative humidity for optimal shelf life.

### WarmMark Short Run:

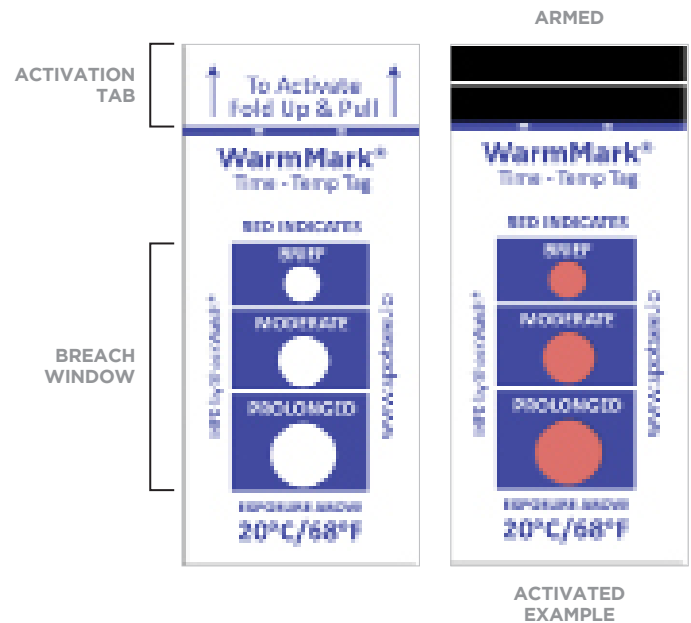


Threshold Temp	Run-Out Times		
	Brief	Moderate	Prolonged
-18°C / 0°F	1 hour	3 hours	12 hours
0°C / 32°F 8°C / 46°F 10°C / 50°F 20°C / 68°F	2 hours	12 hours	48 hours
5°C / 41°F 25°C / 77°F 32°C / 89°F 35°C / 96°F 37°C / 99°F	30 minutes	2 hours	8 hours
35°C / 96°F	2 hours	12 hours	36 hours

Threshold Temp	Run-Out Times
8°C / 46°F	8 hours
8°C / 46°F	12 hours
25°C / 77°F	8 hours
26°C / 79°F	48 hours

## How to Use the WarmMark®


### WarmMark Long Run:

Threshold Temp	Run-Out Times				
	Line 1	Line 2	Line 3	Line 4	Line 5
10°C / 50°F	12 hours	30 hours	60 hours	110 hours	168 hours
31°C / 88°F	12 hours	30 hours	60 hours	110 hours	168 hours

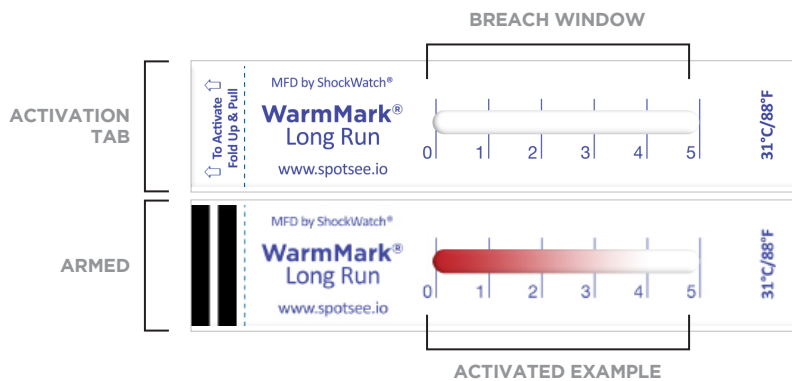

### WarmMark Duo:

Threshold Temp	Run-Out Times			
	Window 1	Window 2	Window 3	Window 4
10°C / 50°F	3 days	8 days	14 days	-
34°C / 93°F	-	-	-	Within 30 mins

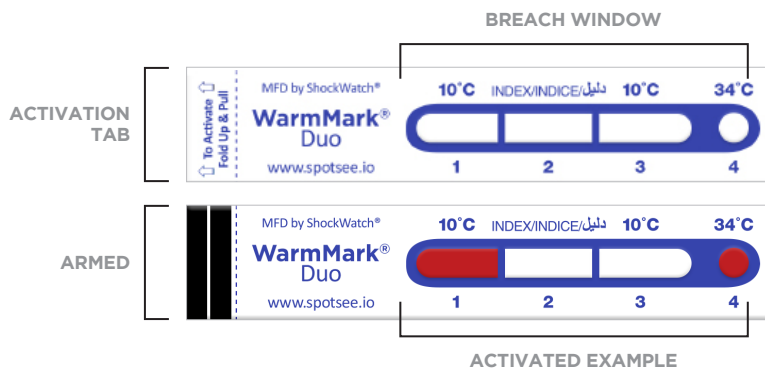

For questions or trouble shooting, please contact Technical Support at:

email: [techsupport@spotsee.io](mailto:techsupport@spotsee.io) | US: +1 800-466-0101 | Outside US: +1 214-736-4579